

Drive Chain / Drive Train / Drive Shaft

Diagnostic Information and Procedures

Drive Chain and Sprocket Symptom Diagnosis


BENE31J13104001

Condition	Possible cause	Correction / Reference Item
Noisy Drive Chain	Worn sprocket.	Replace. (Page 3A-3) (Page 3A-5)
	Worn drive chain.	Replace. (Page 3A-8)
	Stretched drive chain.	Replace. (Page 3A-8)
	Too large drive chain slack.	Adjust. (Page 3A-2)
	Drive chain out of adjustment.	Adjust. (Page 3A-2)

Repair Instructions

Drive Chain Related Components

BENE31J13106010

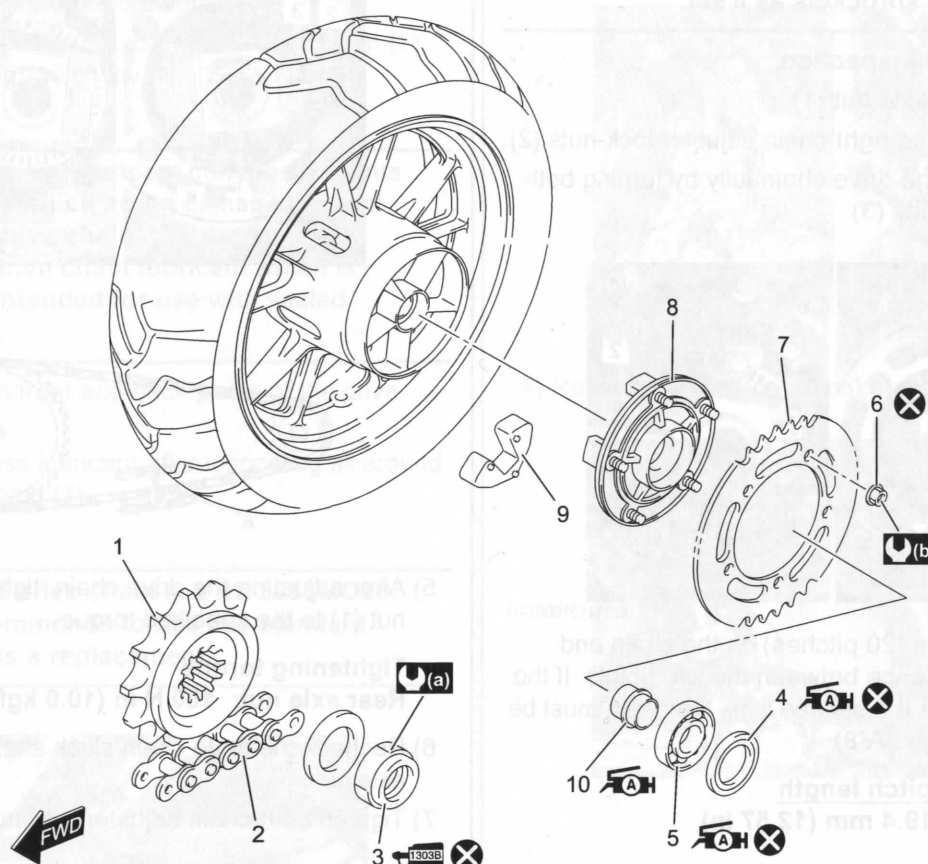

IE31J1310039-04

1. Engine sprocket	6. Rear sprocket nut	(a) : 115 N-m (11.5 kgf-m, 83.5 lbf-ft)
2. Drive chain	7. Rear sprocket	(b) : 60 N-m (6.0 kgf-m, 43.5 lbf-ft)
3. Engine sprocket nut	8. Rear sprocket mounting drum	AH : Apply grease.
4. Dust seal	9. Wheel damper	1303B : Apply thread lock to thread part.
5. Bearing	10. Retainer	X : Do not reuse.